

Technical Bulletin

MAYTAG®

Type Policy Letter
√ Service Information

Date: March 2004

No: TDL-0047-B
Page 1 of 1

Attention Service Managers
√ Service and Parts Managers

Models SAV2555AWW, SAV2655AWW, SAV205DAWW, SAV365ZAWW,
SAV365AAWW, SAV3655AWW, SAV3710AWW, SAV4655AWW,
SAV4710AWW, SAV405DAWW, SAV5710AWW, SAV515DAWW,
SAV5910AWW, NAV2330AWW, NAV3330AWW, NAV5800AWW,
NAV6800AWW, NAV8800AWW

Brand
Maytag
Amana

A **limited** number of models produced in May, June, and July of 2003 with "CN" at the end of the serial number could have an Air Dome Hose imperfection.

Issue Water overflow on top load washer.

Product
Laundry

Warranty Standard product manufacturing warranty applies.

Action **On a small number of models listed above** if the Water Valve and Pressure Switch are not at fault, inspect the Air Dome Hose for extrusion marks on the inside diameter of the hose. During a water fill the extrusion marks could allow the air to bleed out of the hose causing water to overflow. Replace the Air Dome Hose after confirming the extrusion marks are present. It is not necessary to replace the Water Valve or Pressure Switch if it's determined the Air Dome Hose is at fault.



Extrusion Marks occurring on a small number of Air Dome Hoses.

