

# Technical Bulletin

# MAYTAG®

**Type** Policy Letter  
√ Service Information

**Attention** Service Managers  
√ Service and Parts Managers

**Date:** October 2006

**No:** TDL-0143-B  
Page 1 of 1  
ITDL-0045-B

**Models**

AAV1000AW\*, AAV3000AW\*, AAV7000AW\*, AAV8000AW\*, AAV8005EW\*, AAV9000AW\*, CAV2004AW\*, CAV4000AW\*, CAV4004AW\*, CAV4050AW\*, CW5000\*, CW5500\*, CW6000\*, CW6500\*, CW8000\*, CW8500\*, CW9505\*, HAV2357AW\*, HAV2360AW\*, HAV2460AW\*, HAV2557AW\*, HAV2558AW\*, HAV3460AW\*, HAV4657AW\*, HAV4657EW\*, LNC6760A\*, LNC6764A\*, LNC6766A\*, MAV208DAW\*, MAV2755AW\*, MAV2757AW\*, MAV275SAW\*, MAV308DAW\*, MAV3757AW\*, MAV3758AW\*, MAV3855AW\*, MAV385SAW\*, MAV3905AW\*, MAV3955EW\*, MAV4057AW\*, MAV408DAW\*, MAV4500AW\*, MAV4755AW\*, MAV4757AW\*, MAV4758AW\*, MAV5000AW\*, MAV5057AW\*, MAV551EEW\*, MAV5758AW\*, MAV5920EW\*, MAV5960AW\*, MAV6000AW\*, MAV6057AW\*, MAV6200AW\*, MAV6250AW\*, MAV6257AW\*, MAV6300AW\*, MAV6357AW\*, MAV6650AW\*, MAV7000AW\*, MAV7057AW\*, MAV7200AW\*, MAV7257AW\*, MAV7258AW\*, MAV7357AW\*, MAV7358AW\*, MAV7450AW\*, MAV7504EW\*, MAV7550AW\*, MAV7580EW\*, MAV7600AC\*, MAV7600AW\*, MAV7650AW\*, MAV7657EW\*, MAV7700AW\*, MAV7757AW\*, MAV8000AW\*, MAV8057AW\*, MAV8500AW\*, MAV8600AW\*, MAV8757AW\*, MAV9504EW\*, MAV9600EW\*, MAV9657EW\*, MAV9750A\*, MAVT236AW\*, MAVT346AW\*, MAVT446AW\*, MAVT546EW\*, MAVT754EW\*, NAV3335AW\*, NAV5805AW\*, NAV8805EW\*, PAV2200AW\*, PAV2300AW\*, PAV3100AW\*, PAV3200AW\*, PAV3300AW\*, PAV3360AW\*, PAVS234AW\*, PAVS244AW\*, PAVT234AW\*, PAVT244AW\*, PAVT344AW\*, PAVT444AW\*, PAVT454EW\*, PAVT910AW\*, PAVT915AW\*, PAVT920AW\*

**Brand**  
Admiral  
Amana  
Crosley  
Hoover  
Magic Chef  
Maytag

**Product**  
Laundry


**Issue** Melted Motor Pulley.

**Warranty** Standard product manufacturing warranty applies.

**Action** As an alternative to removing and replacing the entire motor assembly from the washer, a new pulley kit, part number 12002815, has been created. This will allow you to replace only the pulley on the motor and save you time in the home and be less expensive for the consumer. The pulley kit is comprised of two pulleys for the two different motors used on the washers.

**NOTE: It is important to replace the correct pulley onto the motor**, by matching the pulley on the motor with the matching pulley in the package. The kit comes with simple instructions on how to remove the pulley from the motor shaft.

Part No. 21001516, motors built **before 8/18/03** requires old pulley part number 21001506.

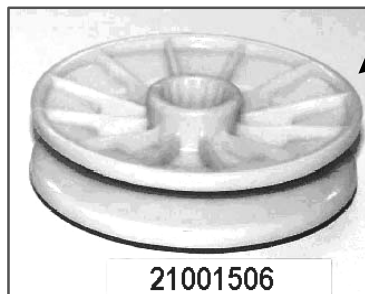

Part No. 21001950, motors built **after 8/18/03** requires new pulley part number 22004297.